

## BULLE ERMAX ADAPTABLE SUR YAMAHA MT10 2022 → ∞

Durée estimée de montage : 15 min  
Niveau de difficulté : 1

**Outil**  
Clé Allen 3 - Clé Allen 4




### Démontage

Déposer la bulle d'origine en ôtant les 4 vis d'origine.  
Déposer les inserts caoutchouc d'origine.  
Retirer la lèvres caoutchouc (simplement emboîtée : tirer vers soi).

### Montage – Ph01

Ôter les 2 vis supérieures (2) de la platine de fixation.  
Débloquer la vis inférieure (2) sans la retirer.  
Remplacer les 2 vis du dessus par les 2 vis (4) fournies, en intercalant sous la platine les 2 entretoises fournies (3). Ne pas oublier de bloquer la vis inférieure (2).  
Monter les 2 inserts caoutchouc ép.5mm fournis (5) en bas, et les 2 inserts caoutchouc ép.10mm fournis (7) en haut.  
Fixer la bulle ERMAX avec les 2 vis lg.25mm fournies (6) en bas, et les 2 vis lg.30mm fournies (8) en haut, en plaçant les 4 rondelles fournies (9) sous les têtes des vis.

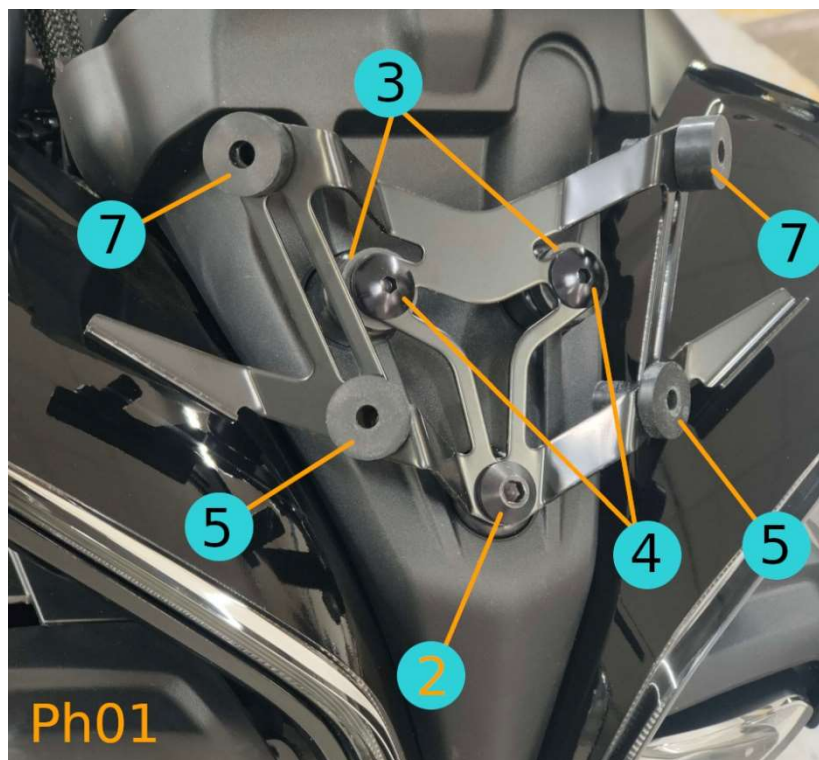

Réf	Désignation	Qté
1	Bulle ERMAX	1
2	Vis Bhc M6 origine	3
3	Entretoise D6x20 ép5mm Plastique noir	2
4	Vis Bhc M6 x 30 Acier noir	2
5	Insert caoutchouc M5 ép 5mm	2
6	Vis BHc M5 x 25 Alu noir	2
7	Insert caoutchouc M5 ép 10mm	2
8	Vis BHc M5 x 30 Alu noir	2
9	Rondelle D5 Plastique noir	4

Bonne route !

#### AVERTISSEMENT

- \* Tout accessoire monté ne sera plus considéré comme neuf et ne sera **ni repris ni échangé**.
- \* Les accessoires Ermax sont conçus pour des **montes d'origine**. Ils ne seront pas garantis s'ils sont utilisés dans d'autres conditions.
- \* En raison des tolérances de fabrication des véhicules, indépendantes de notre volonté, certains produits Ermax peuvent nécessiter des ajustements lors de la fixation.
- \* Les marques de fabricant de motos citées sont indiquées exclusivement comme référence nécessaire à la destination des accessoires Ermax.\* Attention aux serrages excessifs qui pourraient abimer ou casser nos accessoires en plastique et les vis en aluminium.
- \* Les bulles abimées par un **lavage inadéquat** ne sont pas garanties (dissolvant, essence, détergent, produits abrasifs, corrosifs...). Essuyer immédiatement les liquides de frein ou de batterie qui pourraient déborder sur les accessoires.

## ERMAX WINDSHIELD SUITABLE FOR YAMAHA MT10 2022 → ∞

Estimated assembly time : 15 min

Difficulty level : 1

### Tool

3 mm Allen wrench - 4 mm Allen wrench



### Disassembly

Remove the original screen by removing the 4 original screws.  
Remove the original rubber inserts.

Remove the rubber lip (simply fit: pull towards you).

### Assembly – Ph01


Remove the 2 upper screws (2) of the fixing plate.

Unlock the lower screw (2) without removing it.

Replace the 2 top screws with the 2 provided screws (4),  
inserting the 2 spacers provided (3) under the mounting plate.  
Do not forget to block the lower screw (2).

Fit the 2 supplied 5mm thick rubber inserts (5) at the bottom,  
and the 2 supplied 10mm thick rubber inserts (7) at the top.

Fix the ERMAX screen with the 2 lg.25mm screws supplied  
(6) at the bottom, and the 2 lg.30mm screws supplied (8) at  
the top, by placing the 4 washers supplied (9) under the heads  
of the screws.

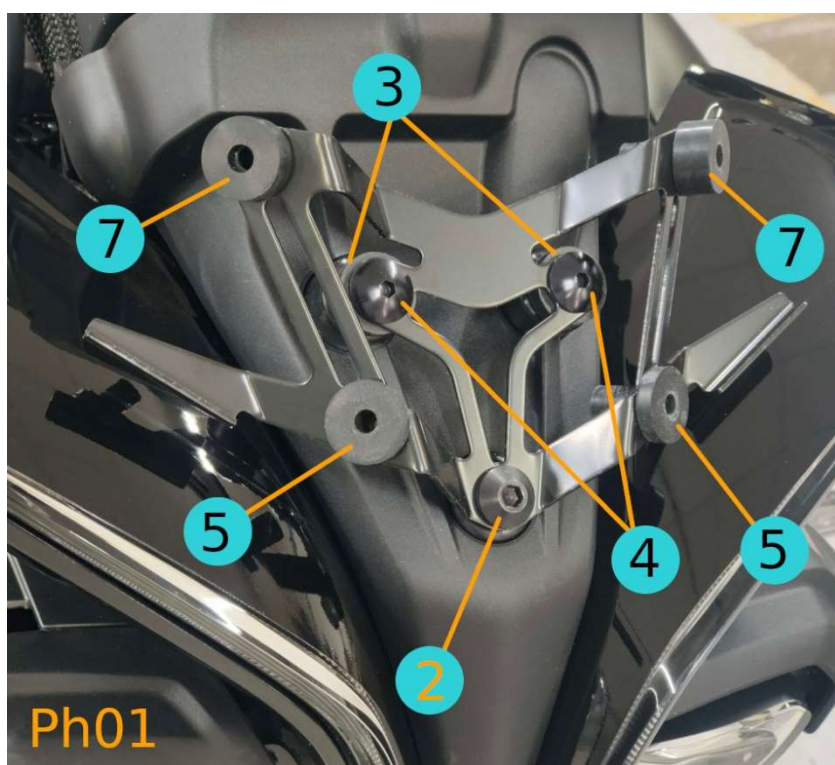

Ref	Description	Qty
1	ERMAX Windshield	1
2	Original Bhc M6 screw	3
3	Spacer D6x20 5mm thick Black plastic	2
4	Bhc M6 x 30 screw Black steel	2
5	M5 rubber insert 5mm thick	2
6	BHc screw M5 x 25 black aluminum	2
7	M5 rubber insert 10mm thick	2
8	BHc screw M5 x 30 black aluminum	2
9	D5 washer Black plastic	4

Have a nice trip !

### « CAUTION »

\* Accessories gone up on the motorbike will not be any more considered as new and will be **neither retaken nor exchanged**.

\* Ermax accessories are foreseen for **original equipments**. They will not be guaranteed if they are used in others conditions.

\* Due to vehicles made tolerances, beyond our control, some Ermax products might need adjustments to fit.

\* Care to excessive clampings which may damage or break our plastic accessories and aluminium screws.

\* The mentioned label of motorbikes's manufacturers are indicated exclusively as a reference to Ermax accessories.

\* Screens damaged by an **inadequat washing** are not guaranteed (abrasive, corrosive ... products, solvent, thinner, benzine ...). Wash immediately brake or battery fluid which may flow on accessories.